



State of Ohio Environmental Protection Agency

# Sanitary Sewer Overflow 5-Day Follow Up Report

Ohio EPA Form 4237  
Issued 08/04

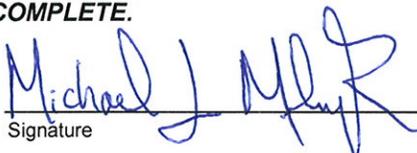
Report Submitted by:	
Date	07/07/15
Facility Name	Gary L. Kron Water Reclamation Facility
Ohio NPDES Permit No.	3PK00033*MD
Period Covered by Report	7-6-15
Contact Person Name	Michael Melnyk
Contact Person Title	Asst. Superintendent
Mailing Address	8471 Lakeshore Blvd.
City, State, Zip	Mentor, Ohio 44060
County	Lake
Telephone No.	(440) 350-3431
E-mail Address	mmelnyk@lakecountyohio.gov

Signature required at end of form

Overflow Information	
Event start date and time – if multiple locations, include information for each	7/6/15 8:30 am
Event end date and time	7/6/15 12:30 pm
Location(s) the SSO – include unique ID number if one exists	301 Olive Street, Grand River OH 44077 (Williams Lift Station force main)
Destination(s) of overflow	<input type="checkbox"/> Basement or building <input checked="" type="checkbox"/> Ground <input type="checkbox"/> Storm sewer to receiving water <input type="checkbox"/> Directly to receiving water
Specific receiving water(s) (if applicable)	N/A
Estimated volume (million gallons) – if multiple locations, include volume for each	.104 MGD
Sewer system component(s) from which release occurred	<input type="checkbox"/> Manhole <input type="checkbox"/> Constructed overflow <input checked="" type="checkbox"/> Pipe crack <input type="checkbox"/> Pump station <input type="checkbox"/> Other (explain)
Cause(s) of overflow	<input type="checkbox"/> Extreme weather <input type="checkbox"/> Equipment failure <input type="checkbox"/> Power failure <input type="checkbox"/> Debris in line <input type="checkbox"/> Roots <input type="checkbox"/> Grease <input type="checkbox"/> Other blockages <input checked="" type="checkbox"/> Line deterioration <input type="checkbox"/> Vandalism <input type="checkbox"/> Other (explain)

Steps taken or planned to eliminate and/or reduce the overflow – include schedule of major milestones	Burgess & Niple Engineering recently completed a sanitary sewer assessment in the Village of Grand River. The Lake County Department of Utilities will be searching for interested contractors to perform repairs to areas of concern.
Steps taken or planned to prevent reoccurrence of the overflow(s) – include schedule of major milestones	An eight (8) inch by twenty (20) inch repair clamp was installed on force main.
Steps taken or planned to mitigate the impact(s) of the overflow(s) – include schedule of major milestones	The following lift stations were temporarily shutdown while repair was being made; Williams St. LS, River LS, Richmond St. LS, and Glyco II LS. Five (5) to eight (8) tons of slag was used when backfilling area around force main to stabilize. Lake County positioned tankers at the site of the break and at lift station of concern to mitigate impact of overflow while repairs were being made.
Additional information (attach additional pages, maps, etc. as needed)	

**I CERTIFY THAT I HAVE PERSONALLY EXAMINED AND AM FAMILIAR WITH THE INFORMATION IN THIS REPORT AND ALL ATTACHMENTS. I BELIEVE THAT THE INFORMATION IS TRUE, ACCURATE, AND COMPLETE.**

  
 \_\_\_\_\_  
 Signature

  
 \_\_\_\_\_  
 Date

Asst. Superintendent  
 \_\_\_\_\_  
 Title